

Date: Tuesday, 16/12/2008 3:17:00 PM
 User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	212/205 HIGH AFT X-TUBE ASSEMBLY
Job Number :	44138		
Estimate Number :	10257		
P.O. Number :		Part Number :	D212664201
This Issue :	16/12/2008	Drawing Number :	D212-664-241 REV C
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	//	Drawing Revision :	C
Previous Run :	44137	Material :	
Written By :		Due Date :	05/01/2009
Checked & Approved By :	JLD 08.12.16	Qty:	1 Um: Each
Comment :	Est Rev:E 04.02.16 Reformat K/DS Est Rev:F 06-03-29 Remove Comments on Pick List JLM Est Rev:G 07-04-30 As per Rev C JLM Est Rev:H 08-05-22 up date Qty of rubber cushion DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



for JLD 08/12/23

**Comment:** DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D212-664-201CHG003

S 09.06.14

2.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------

**Comment:** PACKAGING RESOURCE #1

3.0	D212664201TRN	Crosstube Turning Detail
-----	---------------	--------------------------

**Comment:** Qty: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)CROSSTUBE TURNING DETAIL
batch P-41584

MB 08-12-07

4.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------

**Comment:** BENDING MACHINE

Bend tube as per Dwg D212-664-241 using CNC bender program 212-af and Folio FT007

MB 08-12-07

5.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------

**Comment:** DIMENSIONAL CHECK OF X-TUBES

UP 09.01.06
 POSITIVE
 P10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D212-664-201 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: 1 Date: 09/01/06
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR: <u>44138</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
09.01.06	4	Tube bent high. SEE. Dim SHEET	CP 09.01.06 per Q51092	Tube fits in drill jig. Acceptable	2/17	S 09/01/06	CP 9/1/06	S 09/01/06

NOTE: Date & initial all entries

Date: Tuesday, 16/12/2008 3:17:00 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 44138

Part Number: D212664201

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551

2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241

4-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241

MB 08-12-30

MB 09-01-05

MB 08-12-30

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 within 24 hours of bending and drilling

MB 09-01-05

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 09/01/06

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/01/06

10.0

OUTSIDE SERV.11

OUTSIDE SERVICE -CROSSTUBES



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 7923

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

C 09/01/08 (1)

11.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

12/9/07 (1)

POSITIVE RECALL

EFFECTIVE 08-12-30 AUTH A

RELEASED W DATE 09-01-06



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 16/12/2008 3:17:00 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 44138

Part Number: D212664201

Job Number:



Seq. #: Machine Or Operation: Description :

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: DIMENSIONAL CHECK

Inspect for damage & ensure results are as per Dwg D212-664-241

ml 09 01 08 (1)

13.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

RT 09-01-08

14.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

ml 09 01 09 (1)

15.0

D29401

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2940-1

Support

40253

RT 09-01-12

16.0

D3595063530

RUBBER CUSHION



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Rubber Cushion

Batch:

39255

RT 09-01-12

17.0

MS2192028

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-28

Clamp

109181

RT 09-01-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 16/12/2008 3:17:00 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 44138

Part Number: D212664201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

18.0	CROSSTUBES	CROSSTUBES RESOURCE 1
------	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond

Batch: 109 900

Expiry Date: 02.08.09

RT 09-01-13

3-Install clamps as per Dwg D212-664-241. Torque clamps to 80-100 in lb.

RT 09-01-14

19.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

502/01/14

20.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

21.0	D34281	Placard
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Placard

Batch: 342 448

22.0	AN640A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M108940

23.0	AN641A	Bolt
------	--------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M107013

9/1/14

SC

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 16/12/2008 3:17:00 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH AFT X-TUBE ASSEMBLY

Job Number: 44138

Part Number: D212664201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

24.0	AN960JD616	Washer
------	------------	--------



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Washer

Batch: M110002

slp

25.0	MS21042L6	Nut
------	-----------	-----



(x)

Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Nut

Batch: M19099

9/1/14

slp

26.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

802/01/14 @

27.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



(x)

Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D212-664-201

9/1/14

830

28.0	QC21	FINAL INSPECTION/W/O RELEASE
------	------	------------------------------



09/01/15

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 09-01-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 144138
Description: Crosstube High Aft (205/212)	Part Number: D212-664-201
Inspection Dwg: D212-664-241 Rev: C	Page 1 of 1

Required Dimension	Min	Max
Height	24.17	24.43
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70

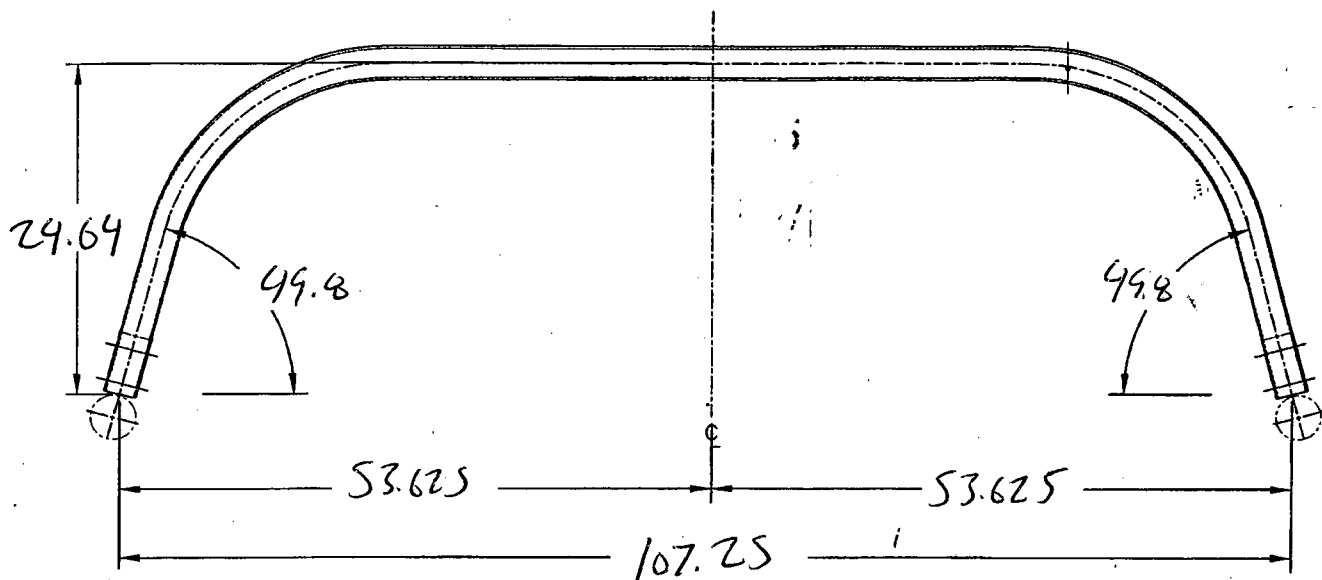

Comments
Tube is high. OK P 09.01.06

QC15 Inspection	P
Date	09.01.06

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. C	KJ/JLM	

DART**RELEASED**
07.04.24 P
PER E.L.N. 0839

DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED J	APPROVED [Signature]	DRAWING NO. D212-664-241	REV. C SHEET 1 OF 3
DATE 07.03.08		TITLE CROSSTUBE ASS'Y (205/212 HI AFT) NTS	
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	07.03.08	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	

Qty	Part Number	Description
X	D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
1	D6006-129	CROSSTUBE
2	D2940-1	SUPPORT
4	D3595-063-530	RUBBER CUSHION
4	MS21920-28	CLAMP (OR MS21920-30)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:




- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.36 ± 0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 10) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE D2940-1 SUPPORT ON TOP SIDE OF CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
NOTE: MS21920-30 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44138



Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07.04.24
PER E-20-037

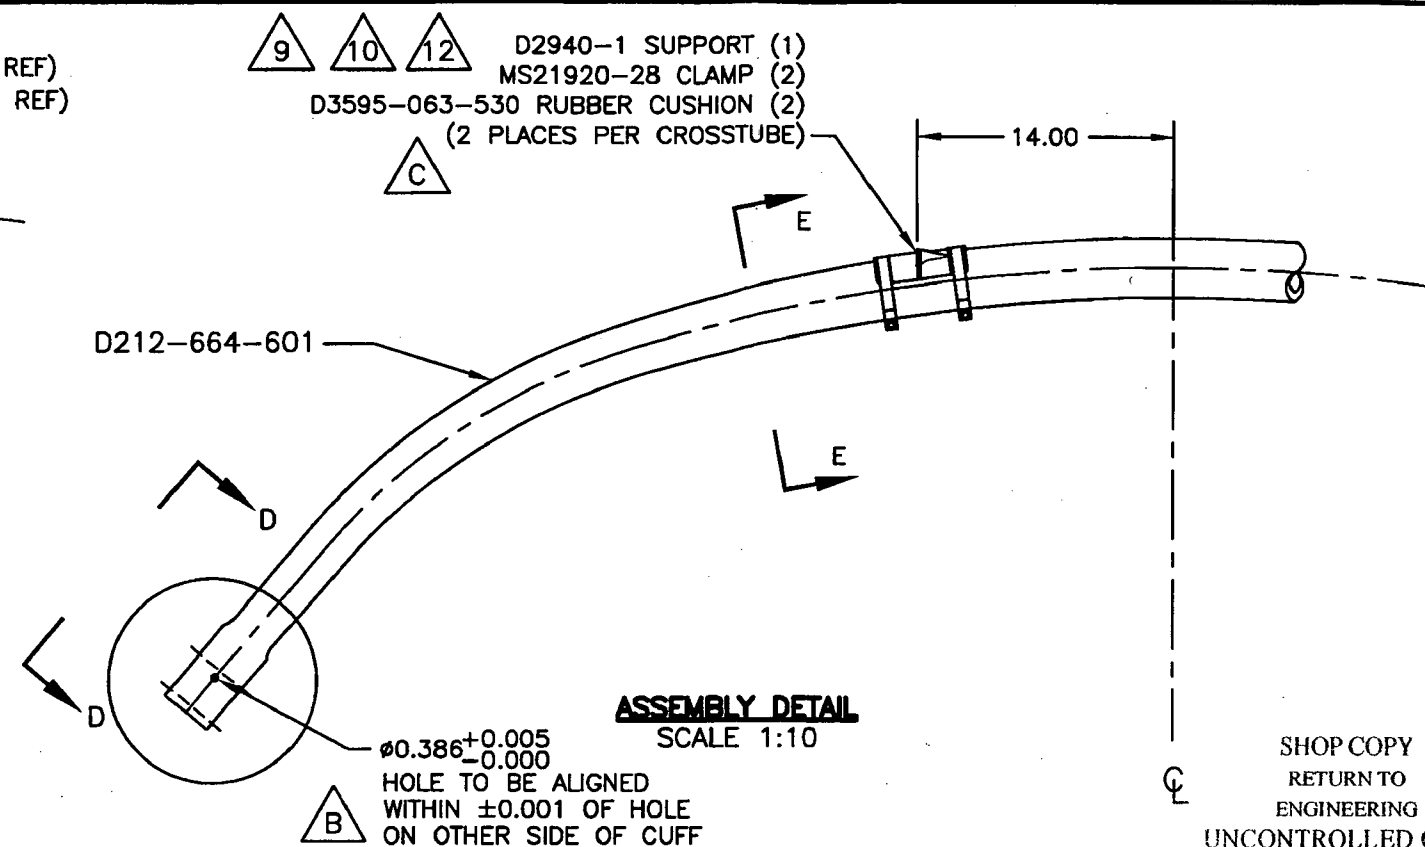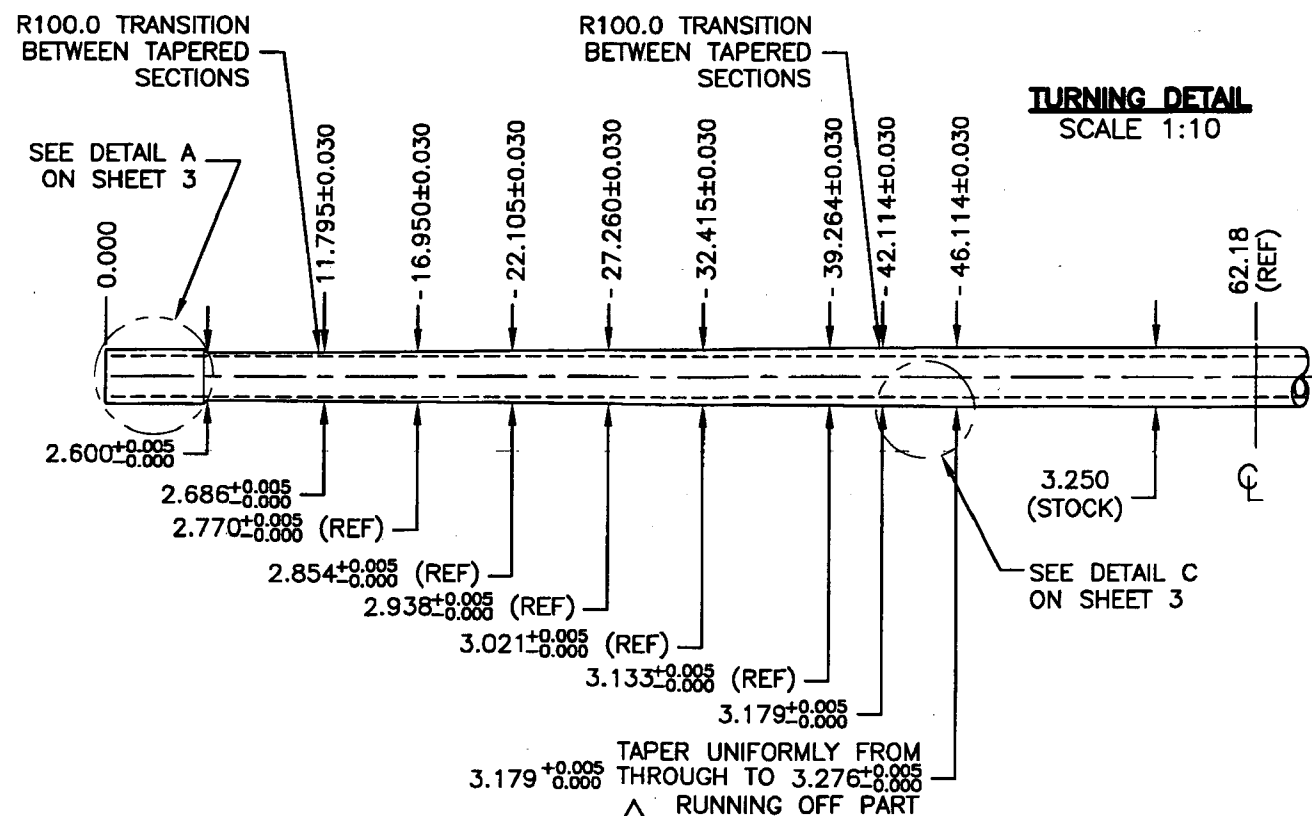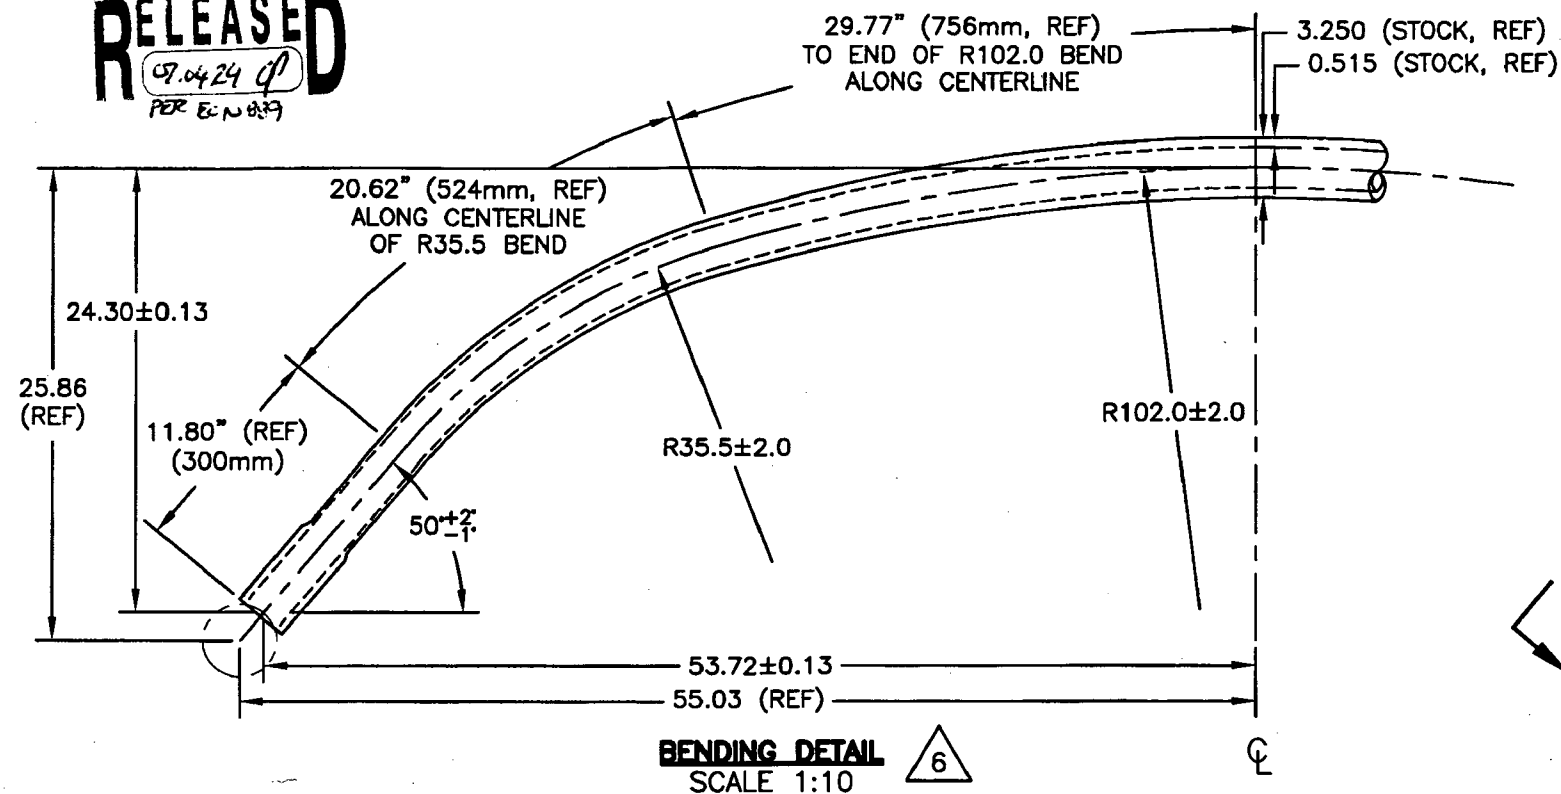

VIEW D-D: CUFF DETAIL
SCALE 2:5

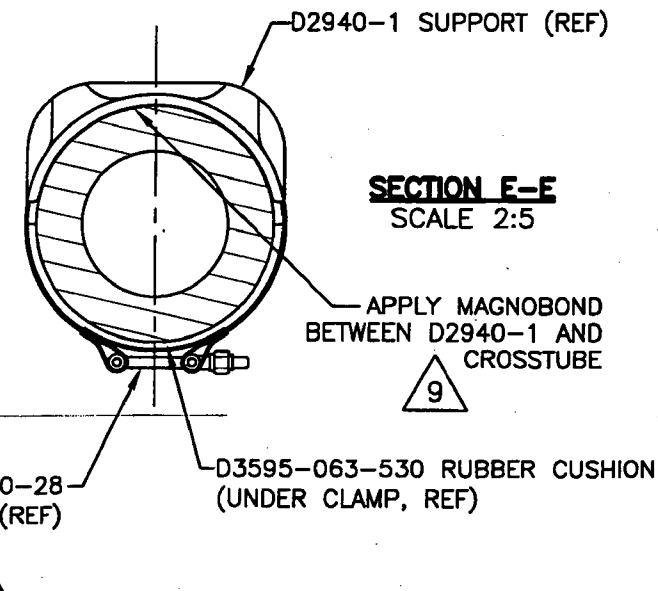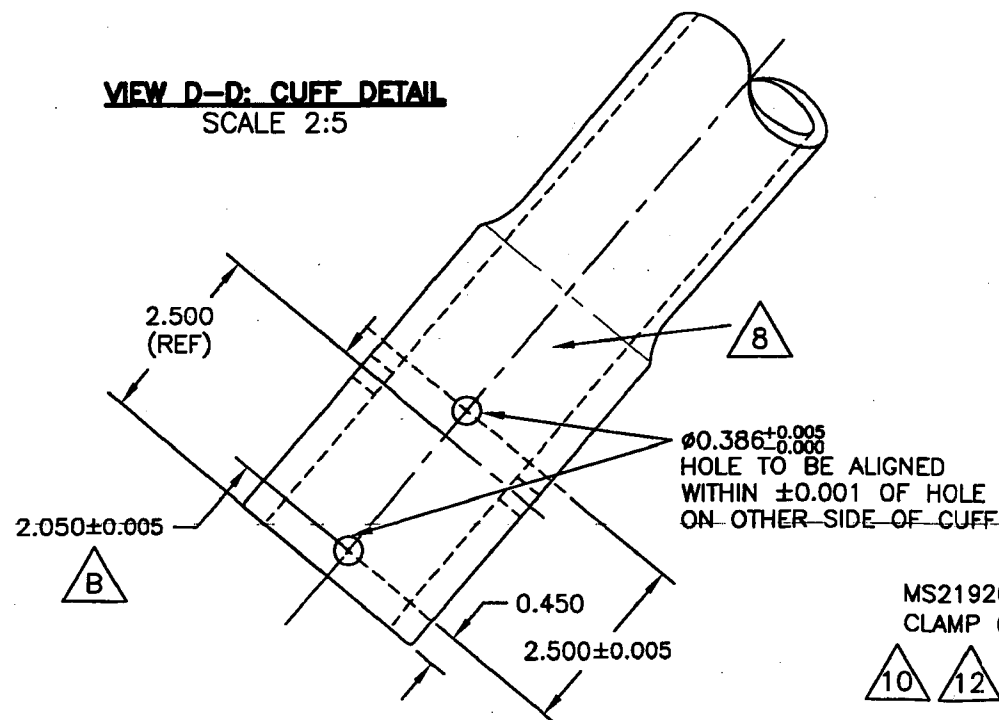

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44138

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN

PH

DRAWN BY

PH

DART

DART AEROSPACE LTD.
HAMPSHIRE, ONTARIO, CANADA

CHECKED

APPROVED

PH

DATE

07.03.08

DRAWING NO.

D212-664-241

REV. C



SHEET 2 OF 3

SCALE

CROSSTUBE ASS'Y (205/212 HI AFT) 1:10


RELEASED
07.04.24 P
PER ECN 889

DETAIL A: CROSSTUBE CUFF

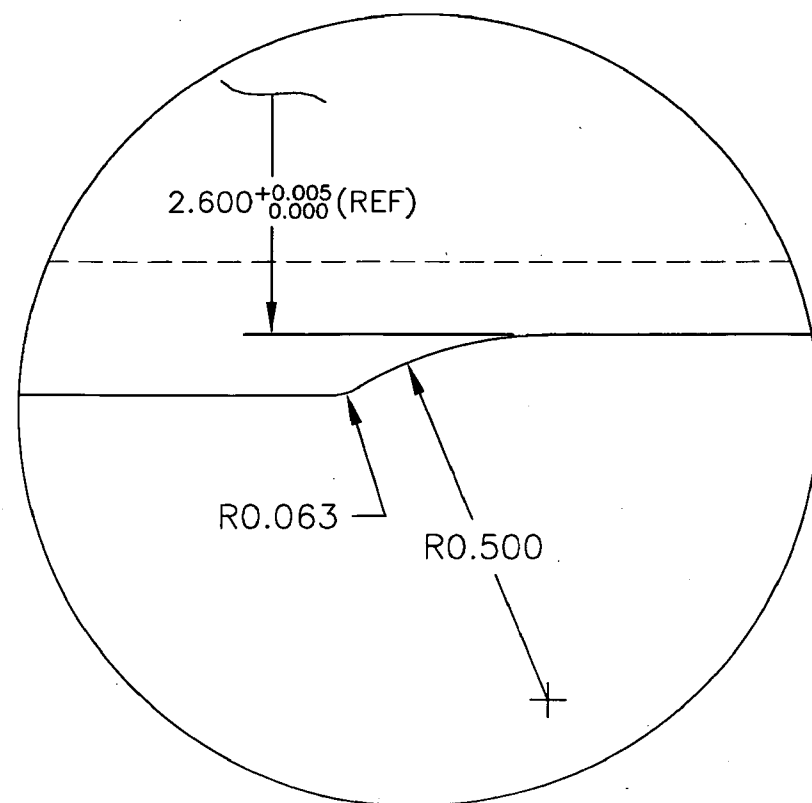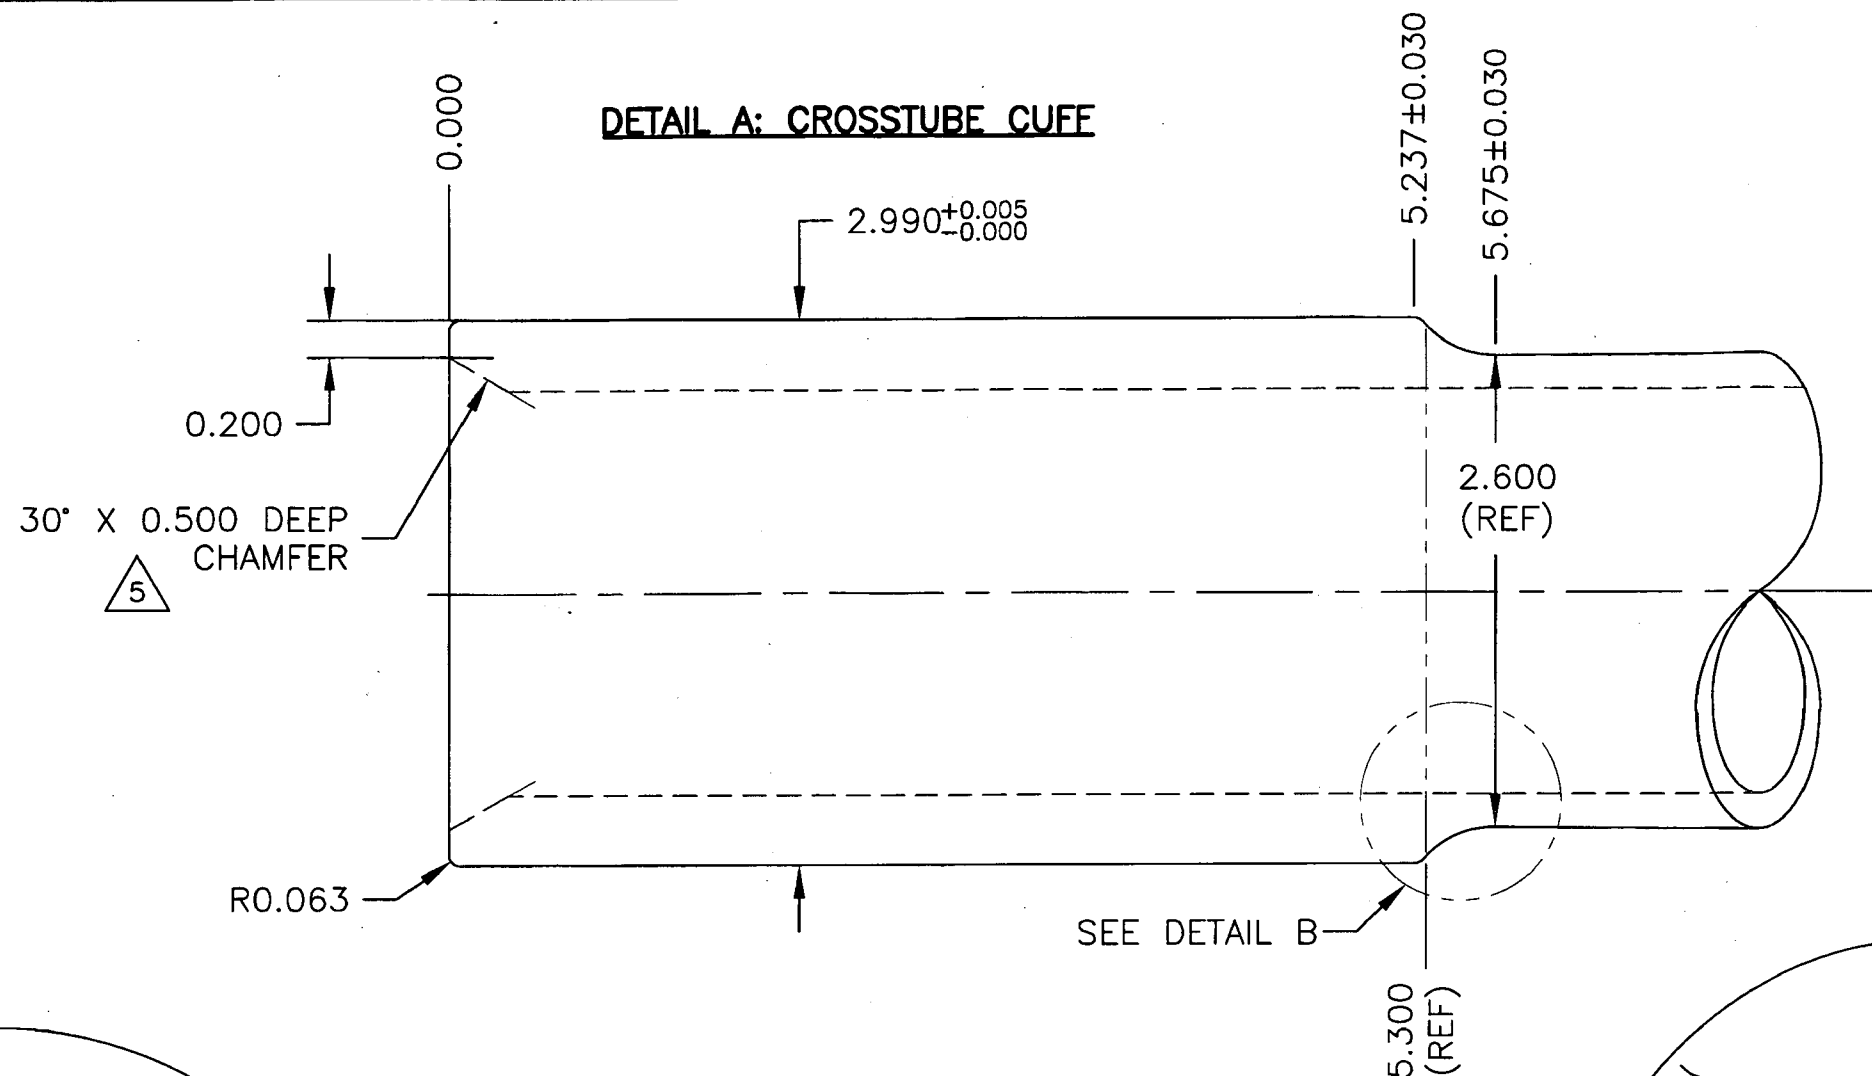

**DETAIL B: CUFF
TRANSITION**
SCALE 4:1

**DETAIL C:
TAPER RUN-OFF**
NOT TO SCALE

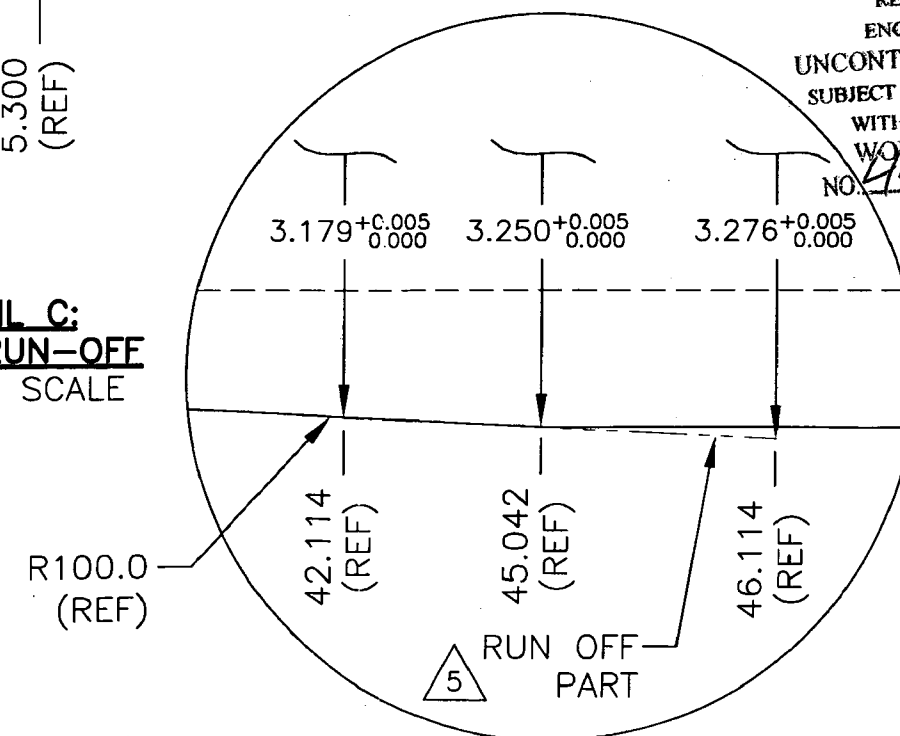

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44138

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN

DRAWN BY

DART

DART AEROSPACE LTD.
HAWKESBURY, ONTARIO, CANADA

CHECKED

APPROVED

DRAWING NO.
D212-664-241

REV. C
SHEET 3 OF 3

DATE

TITLE

SCALE

07.03.08

CROSSTUBE ASS'Y (205/212 HI AFT)

1:1



LIQUID PENETRANT TEST REPORT

P- 09135

PAGE 1 OF 1

CLIENT Dart Aerospace DATE Jan 7, 2009 TIME AM ☐ PM ☐
ATTENTION Linda Lacelle ACUREN JOB NO. 188-08-1660
ADDRESS 1270 Aberdeen St, POWO No. 7923
Hawkesbury, Ont, K6A 1K4 WORK LOCATION Hawkesbury
ACCEPTANCE STD. ASTM 1417-05-1-038 REV./DATE 2005
PROJECT 206 BAFT X-TUBE, 206 FWD X-TUBE, 212/205 HIGH AFT X-TUBE ASSEMBLY
ITEM(S) EXAMINED Job #'s 44141, 44142, 44137, 44138, 44212, 44213

JOB DESCRIPTION PROCEDURE No. LT-002 REV./DATE TECHNIQUE No. LT-002 REV./DATE
PART No. D206667201, D206667103B4, D212664201 MATERIAL ALODINE ALUM. THICKNESS N/A
SCOPE WET FLOUORESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON
NOZZLE external surface

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAPLUX BLACK LIGHT S/N B171 ☐ OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
PENETRANT MINIMUM DWELL TIME 30 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H₂O MINIMUM DRY TIME >10 MIN. OTHER CAL FEB 09
DEVELOPER SKPS3 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (<input type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL)		ACCEPT	REJECT
ITEM	COMMENTS		
14137	Acceptable	✓	
14138		✓	
14141		✓	
14142		✓	
14212		✓	
14213		✓	

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.
Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES
CLIENT REPRESENTATIVE Jan Titley PRINT Jan Titley SIGNATURE
TECHNICIAN (SIGNATURE): Frederick Chagnon
NAME (PRINT): Frederick Chagnon 1ST TECHNICIAN
CGSB LEVEL II SNT LEVEL II CGSB REG. No. 10560
2ND TECHNICIAN
CGSB LEVEL _____ SNT LEVEL _____
CGSB REG. No. _____
DTR #
REPORT REVIEWED BY:
NAME INITIALS

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

PT Sept 2005